

## Optional accessories

**07GZA000:** Scriber

**953638:** Holding bar for test indicator (length: 50mm)

**900209:** Holding bar for test indicator (length: 100mm)

**953639:** Holding bar for test indicator (length: 2")

**900306:** Holding bar for test indicator (length: 4")

**900321:** Swivel clamp used with holding bar (metric)

**900322:** Swivel clamp used with holding bar (inch)

**902053:** Clamp (with dovetail groove,  $\phi 6$  and  $\phi 8$  holes)

Note: A test indicator can be mounted on a height gage using a holding bar and clamp.

## Dial Height Gage SERIES 192 — With digital counter


- Easy and error-free reading with both up and down digital counters as well as a dial.



- Fits comfortably in the hand and moves easily on the surface plate.



- Can be zero-set at any arbitrary position.
- Provided with a large adjustment wheel for easy height adjustment.
- Clamp can be operated easily and securely.

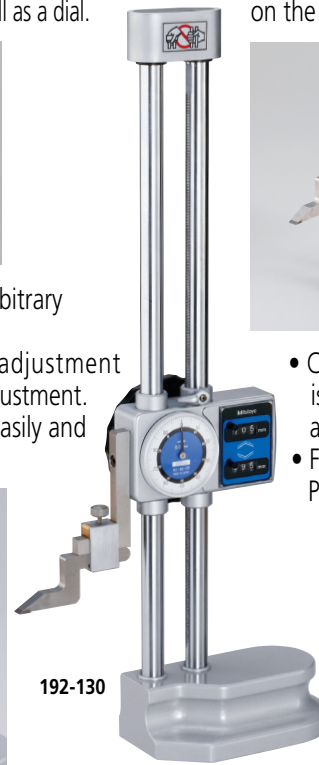

192-130

- Carbide tipped scriber (**No. 07GZA000**) is attached as standard. (Standard accessory: Scriber clamp **No.05GZA033**)
- For precision Black Granite Surface Plates, refer to page E-51.

## SPECIFICATIONS

Metric					
Order No.	Range	Accuracy	Graduation	Height	Mass
192-130	0 - 300mm	±0.03mm	0.01mm	470mm	4.2kg
192-131	0 - 450mm	±0.05mm		648mm	9.2kg
192-132	0 - 600mm			798mm	9.8kg
192-133	0 - 1000mm	±0.07mm		1220mm	17.0kg
Inch					
Order No.	Range	Accuracy	Graduation	Height	Mass
192-150	0 - 12"	±.0015"	.001"	470mm	4.2kg
192-151	0 - 18"	±.002"		648mm	9.2kg
192-152	0 - 24"			798mm	9.8kg
192-153	0 - 40"	±.003"		1220mm	17.0kg

## DIMENSIONS

